



Pressure sensor SPAB-P10R-N18-2P-M8

Part number: 553160

FESTO

With relative pressure 0 to 10 bar.

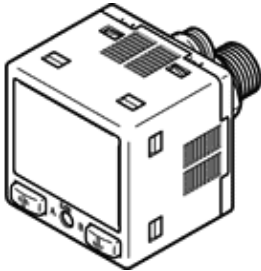

Data sheet

| Feature | Value |
|---|--|
| Authorisation | C-Tick c UL us - Recognized (OL) |
| CE mark (see declaration of conformity) | to EU directive for EMC |
| Materials note | Contains PWIS substances Conforms to RoHS |
| Measured variable | Relative pressure |
| Measurement method | Piezoresistive pressure sensor with display |
| Pressure measuring range, initial value | 0 bar |
| Pressure measuring range, final value | 10 bar |
| Overload range | 15 bar |
| Operating medium | Compressed air in accordance with ISO8573-1:2010 [7:4:4] |
| Note on operating and pilot medium | Lubricated operation not possible |
| Ambient temperature | -10 ... 50 °C |
| Switch output | 2xPNP |
| Switching function | Freely programmable |
| Switching element function | Switchable |
| Switching point reproducibility | 0.2 % |
| Max. output current | 100 mA |
| Precision display FS | 2 %FS |
| Short circuit strength | Yes |
| Operating voltage range DC | 12 ... 24 V |
| Polarity protected | for operating voltage |
| Electrical connection | Plug Round design to EN 60947-5-2 M8x1 4-pin |
| Mounting type | Optional Threaded with accessories |
| Pneumatic connection | Male thread NPT1/8-27 Female thread M5 |
| Product weight | 45 g |
| Materials information, housing | ABS-reinforced PBT-reinforced |
| Type of display | Illuminated LCD, multicoloured |
| Unit(s) that can be displayed | MPa bar kPa psi kgf/cm ² |
| Operating status display | LCD, yellow |
| Setting options | Teach-In Via display and buttons |

| Feature | Value |
|---|-------------|
| Protection against manipulation | PIN-Code |
| Threshold value setting range | 0 ... 100 % |
| Hysteresis setting range | 0 ... 90 % |
| Protection class | IP40 |
| Corrosion resistance classification CRC | 2 |