

Pressure sensors SPAB, with display

FESTO



- 2 - Type discontinued
Available up until 2017

FESTO

Pressure sensors SPAB, with display

Key features, product range overview

At a glance

Variants:

- Plug M8x1 with electric adapter SASC
- Plug, square design L1
- Cable version with connecting cable NEBS

Multi-coloured, two-part display

Alphanumeric display

Displayable units:

- bar
- inchH₂O
- inchHg
- kPa
- psi
- mmHg
- kgf/cm²
- MPa



Compact design
30 x 30 mm

Country-specific pressure
supply ports:

- G1/8
- R1/8
- NPT1/8-27
- M5 female thread

Mounting bracket or front panel
mounting, threaded mounting

High ease of use thanks to
intuitive operator prompting

Product description

The pressure sensor SPAB can be used in many industries thanks to its wide range of connection and configuration options and its compact size.

Switching point settings are emphasised via switching status indication and switching of the display value colour.

Main applications

- Pressure/vacuum sensing
- Light assembly
- Wherever there is a need for space-saving pressure measurement with visualisation and limited robustness
- Easy identification of the system status by means of clear, colour-based switching status detection

Key features

- Pressure measuring range –1 ... +1 or 0 ... 10 bar
- Relative pressure measurement
- Pressure supply port G1/8, R1/8, NPT1/8-27 or M5 female thread
- Electrical connection cable, plug M8x1 or plug, square design
- Switching output PNP, NPN
- Analogue output 1 ... 5 V or 4 ... 20 mA, switchable
- Two-part, multi-coloured display
- Copy function (settings can be transferred from one device to another)
- Simple commissioning thanks to intuitive operation
- Compact design 30x30 mm

Pressure sensors SPAB, with display

Key features, product range overview

Mounting options

Front panel mounting



Manifold sub-bases via mounting bracket



Threaded mounting with adapter M8




Product range overview

Measurement method	Measured variable	Pressure measuring range [bar]	Switching function	Pneumatic connection		Electrical output	
				Male thread	Female thread	Digital	Analogue
Piezoresistive pressure sensor with display	1x relative pressure	-1 ... +1 or 0 ... 10	Freely programmable	G1/8, R1/8 or NPT1/8-27	M5	1x PNP	1 ... 5 V / 4 ... 20 mA
						2x PNP	-
						1x NPN	1 ... 5 V / 4 ... 20 mA
						2x NPN	-

Pressure sensors SPAB, with display

Peripherals overview

FESTO

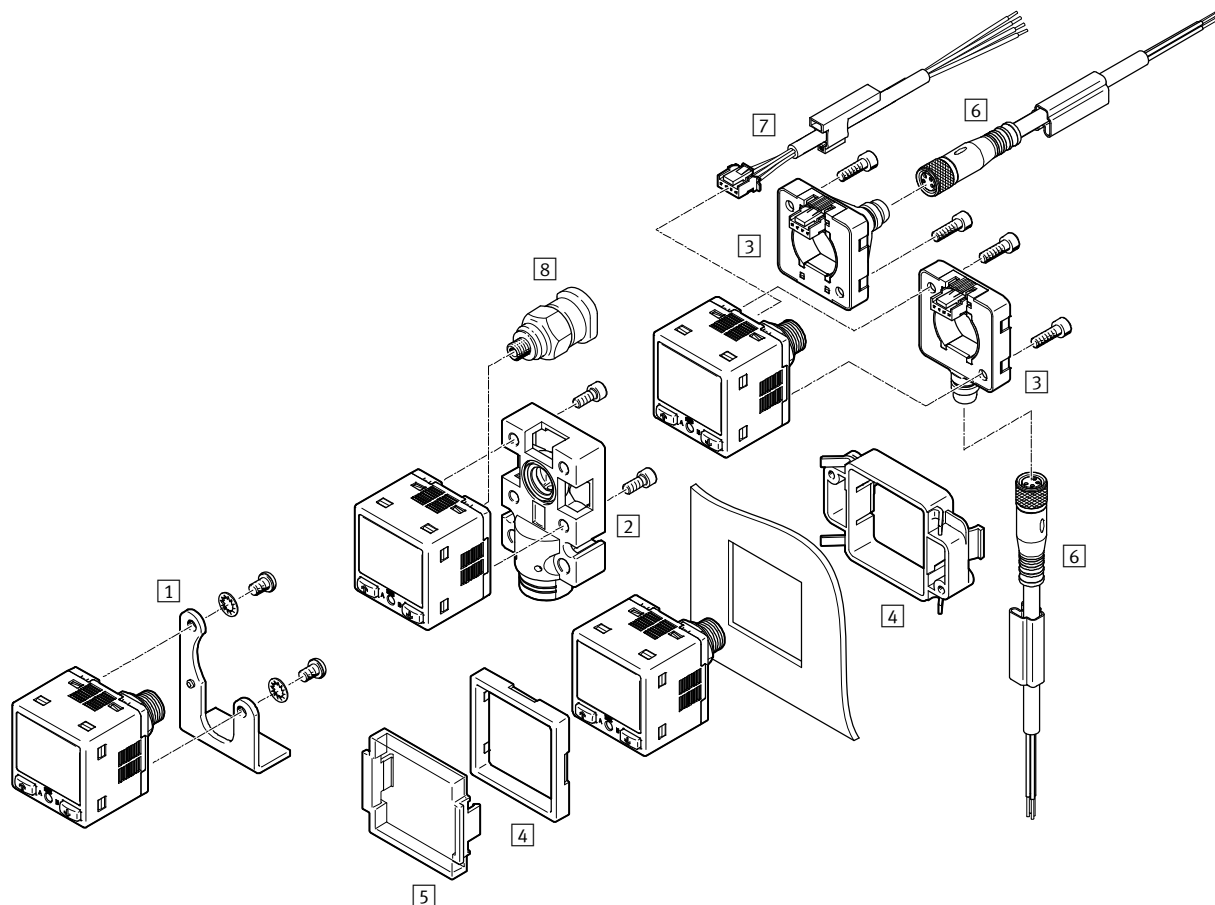

Accessories	→ Page/ Internet
1 Mounting bracket SAMH-...-A	10
2 Adapter plate SASF for pressure sensor SPAB-...-F	13
3 Electric adapter SASC-...-A	11
4 Front panel installation kit SAMH-...-F	10

Accessories	→ Page/ Internet
5 Protective cover SACC	10
6 Connecting cable NEBU-M8	14
7 Connecting cable NEBS-L1G4	14
8 Push-in fitting QSM-M5	14

Pressure sensors SPAB, with display

Type codes

		SPAB	-	P10	R	-	G18	-	PB	-	L1										
Type																					
SPAB	Piezoresistive pressure sensor with multi-coloured display																				
Pressure measuring range [bar]																					
B2	-1 ... +1																				
P10	0 ... 10																				
Pressure input																					
R	Relative pressure																				
Pneumatic connection																					
G18	Male thread G1/8 and female thread M5																				
R18	Male thread R1/8 and female thread M5																				
N18	Male thread NPT1/8-27 and female thread M5																				
F	For adapter plate, female thread M5																				
Electrical output																					
2P	2 switching outputs PNP																				
2N	2 switching outputs NPN																				
PB	1 switching output PNP 1 analogue output 1 ... 5 V / 4 ... 20 mA																				
NB	1 switching output NPN 1 analogue output 1 ... 5 V / 4 ... 20 mA																				
Electrical connection																					
L1	Plug, L1 design																				

- 2 - Type discontinued
Available up until 2017


Pressure sensors SPAB, with display

Technical data


FESTO

Function

E.g. switching output 2x PNP

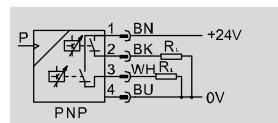

E.g. switching output NPN, analogue output

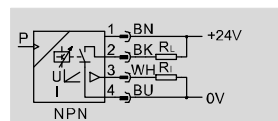

V - Voltage
12 ... 24 V DC

P - Pressure
-1 ... +10 bar

T - Temperature range
-10 ... +50 °C



General technical data			
SPAB		-B2	-P10
General information			
Certification		c UL us - Recognized (OL)	
		RCM trademark	
CE mark (see declaration of conformity)		To EU EMC Directive ¹⁾	
Note on materials		Contains PWIS (paint wetting impairment substances)	
		RoHS-compliant	
Input signal/measuring element			
Measured variable		Relative pressure	
Measurement method		Piezoresistive pressure sensor with display	
Pressure measuring range	[bar]	−1 ... +1	0 ... 10
Overload capacity	[bar]	5	15
Operating medium		Compressed air in accordance with ISO 8573-1:2010 [7:4:4]	
Note on operating/pilot medium		Operation with lubricated medium not possible	
Ambient temperature	[°C]	−10 ... +50	

- 1) For information about the applicability of the component see the manufacturer's EC declaration of conformity at: www.festo.com/sp → User documentation.
If the component is subject to restrictions on usage in residential, office or commercial environments or small businesses, further measures to reduce the emitted interference may be necessary.

Electrical data									
SPAB		-B2				-P10			
Electrical output		2P	2N	PB	NB	2P	2N	PB	NB
Switching output ¹⁾									
Switching output		2x PNP	2x NPN	PNP	NPN	2x PNP	2x NPN	PNP	NPN
Switching function		Freely programmable							
Switching element function		Switchable							
Accuracy of FS display	[%]	1				2			
Reproducibility of switching value	[%]	0.1				0.2			
Max. output current	[mA]	100							
Analogue output ¹⁾									
Analogue output	[V]	–		1 ... 5		–		1 ... 5	
	[mA]	–		4 ... 20		–		4 ... 20	
Accuracy of analogue output zero point ±FS	[%]	–		5		–		5	
Accuracy of analogue output margin ±FS	[%]	–		5		–		5	
Reproducibility of analogue value	[%]	–		0.2		–		0.2	
Output, additional data									
Protection against short circuit		Yes							

1) % FS = % of the measuring range final value (full scale)

Pressure sensors SPAB, with display

Technical data

FESTO

Electrical data								
SPAB	-B2				-P10			
Electrical output	2P	2N	PB	NB	2P	2N	PB	NB
Operating voltage range DC [V]	12 ... 24							
Reverse polarity protection	For all electrical connections							
Electrical connection	Plug, 4-pin, square design							

Pin allocation SPAB- ... -L1			
Plug, 4-pin			
Square design	Pin	Wire colour	Allocation
	1	Brown	Operating voltage 12 ... 24 V DC
	2	Black	Switching output A
	3	White	Switching output B / analogue output, external
	4	Blue	0 V DC

Mechanical components				
SPAB	-G18	-R18	-N18	-F
Type of mounting	Screw-in			On adapter plate
	Via accessories			-
Pneumatic connection	Female thread M5			
	Male thread G1/8	Male thread R1/8	Male thread NPT1/8-27	-
Product weight [g]	45			30
Housing materials	PBT, reinforced			

Display/operation		
SPAB	-B2	-P10
Display type	Illuminated LCD, multi-coloured	
Displayable units	bar	bar
	inchH ₂ O	-
	inchHg	-
	kPa	kPa
	psi	psi
	mmHg	-
	kgf/cm ²	kgf/cm ²
	-	MPa
Switching status display	Yellow LCD	
Setting options	Teach-in	
	Via display and keys	
Tamper protection	PIN code	
Threshold value setting range [%]	0 ... 100	
Hysteresis setting range [%]	0 ... 90	

Immissions/emissions	
Protection class	IP40
Corrosion resistance class CRC ¹⁾	2

1) Corrosion resistance class CRC 2 to Festo standard FN 940070

Moderate corrosion stress. Indoor applications in which condensation may occur. External visible parts with primarily decorative requirements for the surface and which are in direct contact with the ambient atmosphere typical for industrial applications.

- 2 - Type discontinued
Available up until 2017

Pressure sensors SPAB, with display


Technical data

FESTO


Dimensions

Download CAD data → www.festo.com

SPAB-...-L1

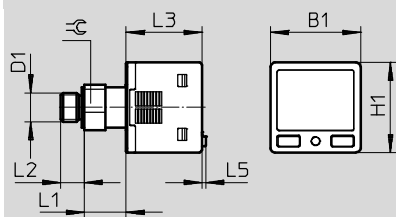

SPAB-...-F-...-L1

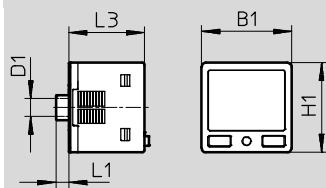

Type	B1	D1	D2	H1	H2	H3	L1	L2	L3	L4	L5	≙
SPAB-...-G18-...-L1	30	G1/8	–	30	–	–	15	7	~25	–	1	14
SPAB-...-R18-...-L1	30	R1/8	–	30	–	–	14	9.5	~25	–	1	12
SPAB-...-N18-...-L1	30	NPT1/8	–	30	–	–	14	9.5	~25	–	1	12
SPAB-...-F-...-L1	30	M5	–	30	–	–	4.4	–	~25	–	–	–

- 2 - Type discontinued
Available up until 2017

Pressure sensors SPAB, with display

FESTO

Technical data

Ordering data				
Pressure measuring range [bar]	Electrical output		Part No.	Type
	Digital	Analogue		
Male thread G1/8 and female thread M5				
-1 ... +1	1 switching output PNP	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000051	SPAB-B2R-G18-PB-L1
	2 switching outputs PNP	–	8000045	SPAB-B2R-G18-2P-L1
	1 switching output NPN	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000054	SPAB-B2R-G18-NB-L1
	2 switching outputs NPN	–	8000048	SPAB-B2R-G18-2N-L1
0 ... 10	1 switching output PNP	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000063	SPAB-P10R-G18-PB-L1
	2 switching outputs PNP	–	8000057	SPAB-P10R-G18-2P-L1
	1 switching output NPN	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000066	SPAB-P10R-G18-NB-L1
	2 switching outputs NPN	–	8000060	SPAB-P10R-G18-2N-L1
Male thread R1/8 and female thread M5				
-1 ... +1	1 switching output PNP	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000052	SPAB-B2R-R18-PB-L1
	2 switching outputs PNP	–	8000046	SPAB-B2R-R18-2P-L1
	1 switching output NPN	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000055	SPAB-B2R-R18-NB-L1
	2 switching outputs NPN	–	8000049	SPAB-B2R-R18-2N-L1
0 ... 10	1 switching output PNP	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000064	SPAB-P10R-R18-PB-L1
	2 switching outputs PNP	–	8000058	SPAB-P10R-R18-2P-L1
	1 switching output NPN	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000067	SPAB-P10R-R18-NB-L1
	2 switching outputs NPN	–	8000061	SPAB-P10R-R18-2N-L1
Male thread NPT1/8-27 and female thread M5				
-1 ... +1	1 switching output PNP	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000053	SPAB-B2R-N18-PB-L1
	2 switching outputs PNP	–	8000047	SPAB-B2R-N18-2P-L1
	1 switching output NPN	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000056	SPAB-B2R-N18-NB-L1
	2 switching outputs NPN	–	8000050	SPAB-B2R-N18-2N-L1
0 ... 10	1 switching output PNP	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000065	SPAB-P10R-N18-PB-L1
	2 switching outputs PNP	–	8000059	SPAB-P10R-N18-2P-L1
	1 switching output NPN	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000068	SPAB-P10R-N18-NB-L1
	2 switching outputs NPN	–	8000062	SPAB-P10R-N18-2N-L1
For adapter plate, female thread M5				
-1 ... +1	1 switching output PNP	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000071	SPAB-B2R-F-PB-L1
	2 switching outputs PNP	–	8000069	SPAB-B2R-F-2P-L1
	1 switching output NPN	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000072	SPAB-B2R-F-NB-L1
	2 switching outputs NPN	–	8000070	SPAB-B2R-F-2N-L1
0 ... 10	1 switching output PNP	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000075	SPAB-P10R-F-PB-L1
	2 switching outputs PNP	–	8000073	SPAB-P10R-F-2P-L1
	1 switching output NPN	1 analogue output 1 ... 5 V / 4 ... 20 mA	8000076	SPAB-P10R-F-NB-L1
	2 switching outputs NPN	–	8000074	SPAB-P10R-F-2N-L1

Pressure sensors SPAB, with display


Accessories



Mounting bracket SAMH

Material:
Galvanised chromated steel

Note on materials:
RoHS-compliant

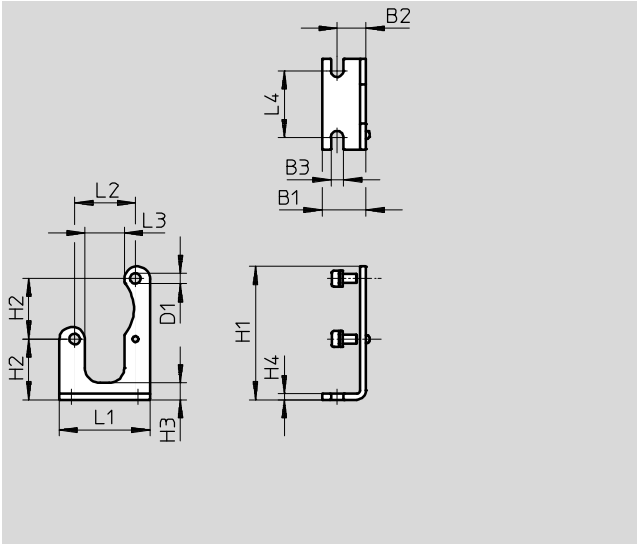


Dimensions and ordering data													Part No.	Type
B1	B2	B3	D1 Ø	H1	H2	H3	H4	L1	L2	L3	L4			
14.5	9.5	4.2	3.5	~44	20	5.5	2	30	20	13	22		552376	SAMH-P4-A

Front panel installation kit SAMH

Materials:
PC, POM

Note on materials:
RoHS-compliant


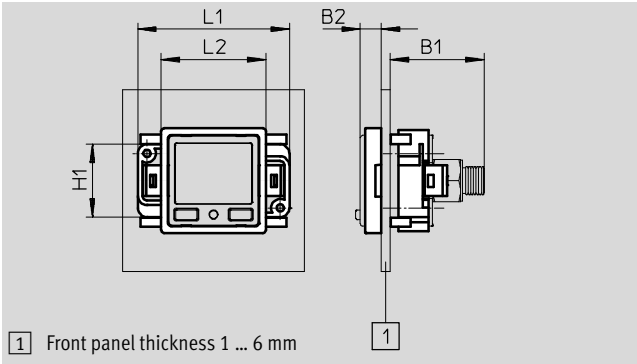


Ordering data						Part No.	Type
B1	B2	H1	L1	L2			
~31	7	24	50	34.5		552377	SAMH-P4-F

Protective cover SACC

Material:
PC

Note on materials:
RoHS-compliant

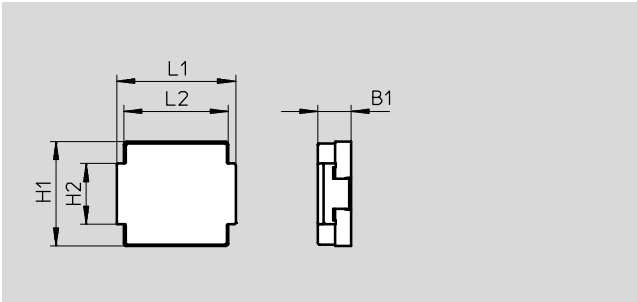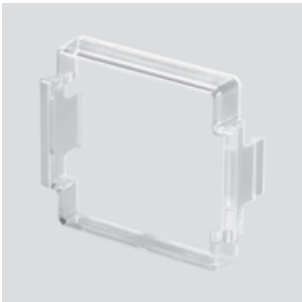

Dimensions and ordering data						Part No.	Type
B1	H1	H2	L1	L2			
~28	34.5	20	39.3	34.5		552378	SACC-P4-G

Pressure sensors SPAB, with display


Accessories



Electric adapter SASC

Material:
Housing: PA-reinforced
Plug housing: Nickel plated brass

Note on materials:
RoHS-compliant

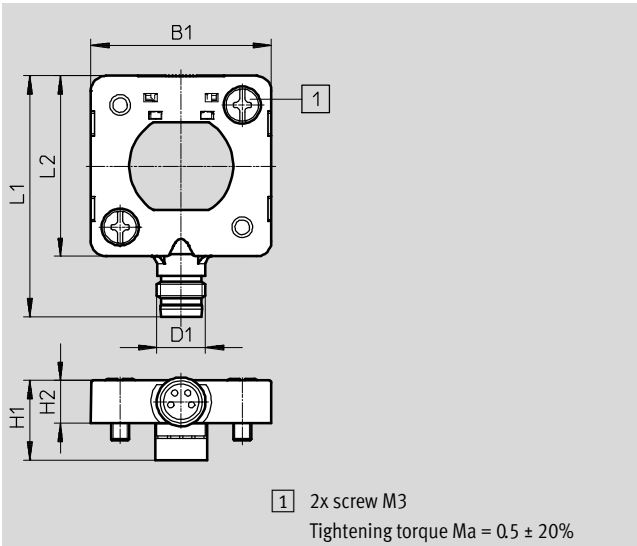

Dimensions and ordering data								
B1	D1 Ø	H1	H2	L1	L2	CRC ¹⁾	Part No.	Type
29.6	M8x1	13	7	39.5	29.6	2	8000326	SASC-P4-A-M8-A

1) Corrosion resistance class CRC 2 to Festo standard FN 940070
Moderate corrosion stress. Indoor applications in which condensation may occur. External visible parts with primarily decorative requirements for the surface and which are in direct contact with the ambient atmosphere typical for industrial applications.

Pin allocation		
Plug, 4-pin, M8x1		
Round design	Pin	Allocation
	1	Operating voltage 12 ... 24 V DC
	2	Switching output B / analogue output, external
	4	Switching output A
	3	0 V DC

Pressure sensors SPAB, with display


Accessories



Electric adapter SASC

Material:
Housing: PA-reinforced
Plug housing: Nickel plated brass

Note on materials:
RoHS-compliant

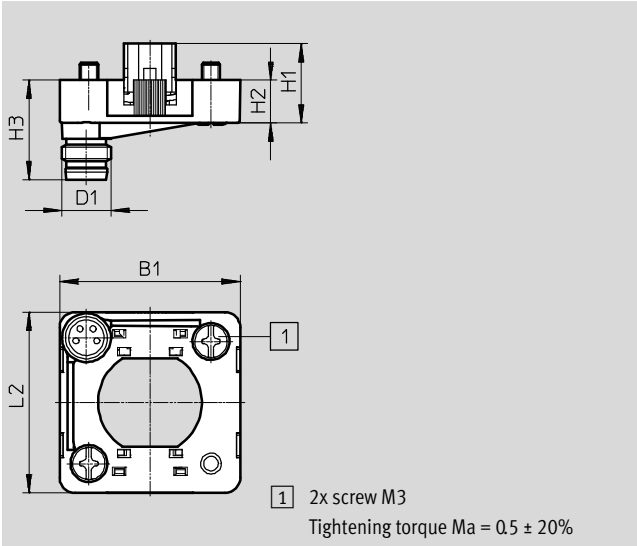

Dimensions and ordering data							
B1	D1 Ø	H1	H2	H3	L2	CRC ¹⁾	Part No. Type
29.6	M8x1	13	7	16.3	29.6	2	8000327 SASC-P4-A-M8-S

1) Corrosion resistance class CRC 2 to Festo standard FN 940070
Moderate corrosion stress. Indoor applications in which condensation may occur. External visible parts with primarily decorative requirements for the surface and which are in direct contact with the ambient atmosphere typical for industrial applications.

Pin allocation		
Plug, 4-pin, M8x1		
Round design	Pin	Allocation
	1	Operating voltage 12 ... 24 V DC
	2	Switching output B / analogue output, external
	3	0 V DC
	4	Switching output A


Pressure sensors SPAB, with display

Accessories

Adapter plate **SASF**
for pressure sensor SPAB-...-F

Materials:
PBT-reinforced
High-alloy stainless steel
HNBR

Note on materials:
Contains PWIS (paint wetting
impairment substances)
RoHS-compliant

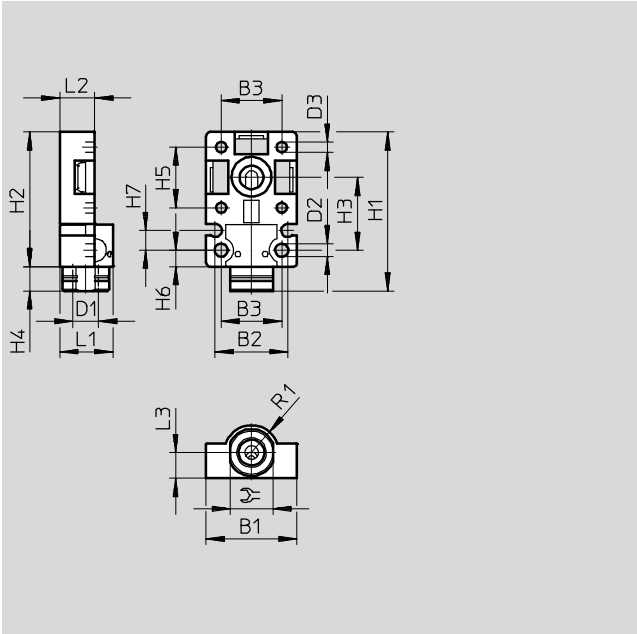

 - Note

To differentiate the adapter plates
R1/8, G1/8 and NPT1/8, they are
identified as follows at the
pneumatic connection:

- R1/8 No line

- NPT1/8 One line

- G1/8 Two lines

Dimensions and ordering data										
B1	B2	B3	D1	D2 Ø	D3 Ø	H1	H2	H3	H4	H5
30	24	20	R1/8	4.3	3.4	52.5	44.5	24	8	20
			G1/8							
			NPT1/8							
30	24	20	M5	4.3	3.4	–	44.5	24	–	20

H6	H7	L1	L2	L3	R1	≡C	CRC ¹⁾	Part No.	Type
5.5	6.5	17.5	11.5	8.5	9	14	2	570801	SASF-P4-P-R18
								570802	SASF-P4-P-G18
								570803	SASF-P4-P-N18
5.5	6.5	17.5	11.5	8.5	9	–		570804	SASF-P4-P-M5

1) Corrosion resistance class CRC 2 to Festo standard FN 940070
Moderate corrosion stress. Indoor applications in which condensation may occur. External visible parts with primarily decorative requirements for the surface and which are in direct contact with the ambient atmosphere typical for industrial applications.

Pressure sensors SPAB, with display

Accessories

FESTO

Ordering data – Connecting cables					Technical data → Internet: nebu	
	Designation	Number of wires	Cable length [m]	Part No.	Type	
	Socket, rectangular design L1	4	2.5	572576	NEBS-L1G4-K-2.5-LE4	
			5	572577	NEBS-L1G4-K-5-LE4	
	Straight socket, M8x1	4	2.5	541342	NEBU-M8G4-K-2.5-LE4	
			5	541343	NEBU-M8G4-K-5-LE4	
	Angled socket, M8x1	4	2.5	541344	NEBU-M8W4-K-2.5-LE4	
			5	541345	NEBU-M8W4-K-5-LE4	

Ordering data – Push-in fittings				Technical data → Internet: qs	
	Pneumatic connection	For tubing O.D. [mm]	Part No.	Type	
	M5	4	153304	QSM-M5-4	
		6	153306	QSM-M5-6	

Festo - Your Partner in Automation



1 Festo Inc.
5300 Explorer Drive
Mississauga, ON L4W 5G4
Canada

Festo Customer Interaction Center
Tel: 1 877 463 3786
Fax: 1 877 393 3786
Email: customer.service.ca@festo.com



2 Festo Pneumatic
Av. Ceylán 3,
Col. Tequesquináhuac
54020 Tlalnepantla,
Estado de México

Multinational Contact Center
01 800 337 8669
ventas.mexico@festo.com



3 Festo Corporation
1377 Motor Parkway
Suite 310
Islandia, NY 11749

Festo Customer Interaction Center
1 800 993 3786
1 800 963 3786
customer.service.us@festo.com



4 Regional Service Center
7777 Columbia Road
Mason, OH 45040

Connect with us

www.festo.com/socialmedia



www.festo.com

Subject to change