

Pressure sensors SPAW

FESTO



Pressure sensors SPAW with display

Key features

FESTO

At a glance



Product description

The SPAW is an extremely robust pressure sensor with display used for measuring media pressures in 9 measuring ranges from at least -1 ... 1 bar to 0 ... 100 bar. It can measure all media which do not damage the stainless steel measuring cell and stainless steel housing. The switching outputs can be set quickly and easily using three buttons. The high-quality 14-segment

LED display can be rotated by 320° and the orientation of the lettering can be rotated by 180°. This ensures that the display is easily readable in every installation position. Different standard designs are available, e.g.:

- Internal thread G $\frac{1}{4}$ or external thread G $\frac{1}{2}$
- 2 x PNP or 2 x NPN
- 4 ... 20 mA or 0 ... 10 V

Main applications


The pressure sensor SPAW is suitable for standard pressure measurements at an increased mechanical load. It can be used in high pressure pneumatic systems and to monitor the pressure of liquid media (e.g. coolant/cooling circuits, etc.)

Pressure sensors SPAW with display


Key features

Application examples


Pressure measurement in air preparation units

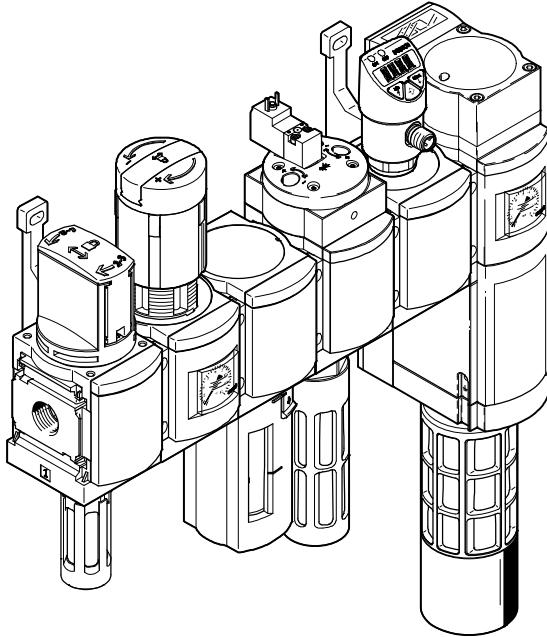


Pressure measurement in piping systems

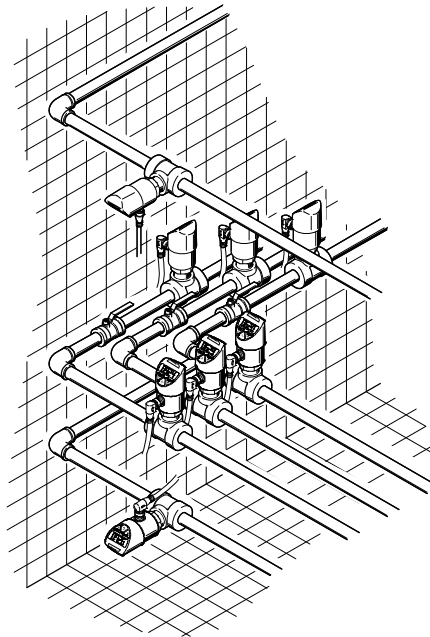

Pressure measurement in filter systems

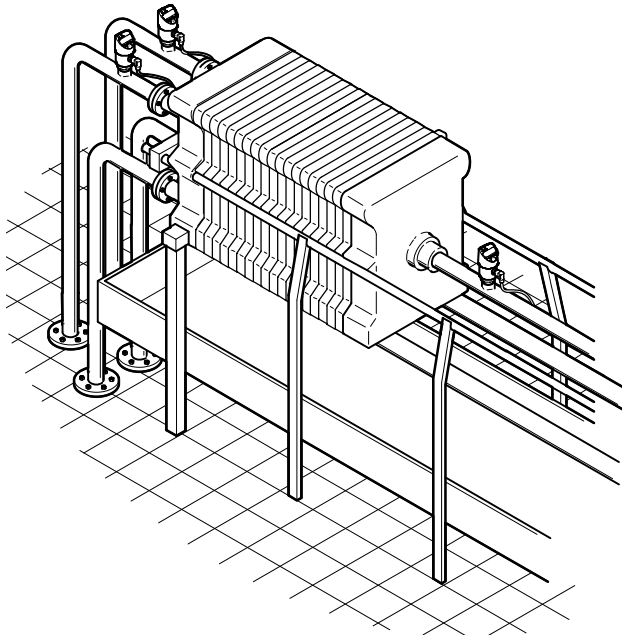


Pressure measurement for cutting oil supply and hydraulic applications

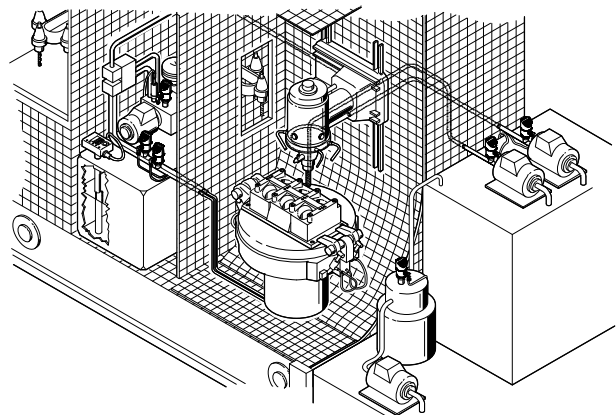

Pressure sensors SPAW with display

Peripherals overview

FESTO

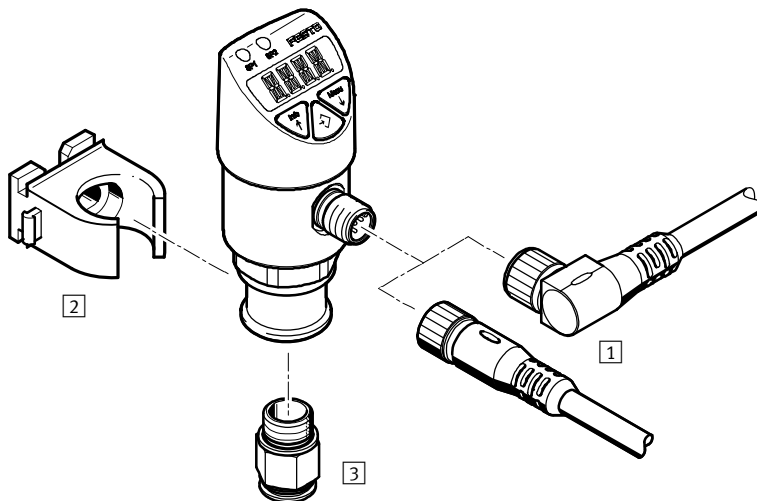

Mounting components and accessories		
	Brief description	→ Page/Internet
1 NEBU-M12	Connecting cable	12
2 PQ-RK-22-B	Pipe clamp, only for G $\frac{1}{4}$ with internal thread	12
3 QS- $\frac{1}{4}$	Push-in fitting, only for G $\frac{1}{4}$ with internal thread	12

Pressure sensors SPAW with display

Type codes

		SPAW	-	B2	R	-	G12	M	-	2P	-	M12
Type												
SPAW	Pressure sensor											
Pressure measuring range [bar]												
B2	-1 ... +1											
B11	-1 ... +10											
P2	0 ... 2											
P6	0 ... 6											
P10	0 ... 10											
P16	0 ... 16											
P25	0 ... 25											
P50	0 ... 50											
P100	0 ... 100											
Supply port												
R	Relative pressure											
Pneumatic connection												
G12	G 1/2											
G14	G 1/4											
Thread type												
F	Internal thread											
M	External thread											
Electrical output												
2P	2xPNP											
2 N	2xNPN											
2PA	2xPNP, 1 analogue output 4 ... 20 mA											
2PV	2xPNP, 1 analogue output 0 ... 10 V											
2NA	2xNPN, analogue output 4 ... 20 mA											
2NV	2xNPN, analogue output 0 ... 10 V											
Electrical connection												
M12	Plug M12, A-coded											


Pressure sensors SPAW with display

FESTO


Technical data

Function

e.g. switching output 2PV



e.g. switching output 2NA



- Pressure measuring range up to 100 bar
- For liquid media
- For gaseous media



General technical data	
General	
Certification	RCM trademark cULus listed (OL)
CE marking (see declaration of conformity) ¹⁾	To EU EMC Directive
Note on materials	RoHS-compliant

1) For information about the applicability of the component see the manufacturer's EC declaration of conformity at: www.festo.com → Support → User documentation.
If the component is subject to restrictions on usage in residential, office or commercial environments or small businesses, further measures to reduce the emitted interference may be necessary.

Input signal/measuring element									
SPAW-	B2R	P2R	P6R	P10R	B11R	P16R	P25R	P50R	P100R
Input signal/measuring element									
Measured variable	Relative pressure								
Method of measurement	Piezoresistive pressure sensor								
Pressure measuring range starting value	–1	0	0	0	–1	0	0	0	0
Pressure measuring range final value	1	2	6	10	10	16	25	50	100
Overload pressure	2	4	12	20	20	32	50	100	200
Operating medium	Compressed air to ISO 8573-1:2010 [–:–:]								
	Liquid media ²⁾								
	Gaseous media ²⁾								
Temperature of medium	–20 ... 85								
Ambient temperature	0 ... 80								



2) Resistance to media of parts that come into contact with the media

Pressure sensors SPAW with display

FESTO

Technical data

Electrical data		
Output, general		
Accuracy	[±%FS]	1
Repetition accuracy	[±%FS]	0.15
Switching output		
Switching function	Freely programmable	
Switching element function	Switchable	
Max. output current	[mA]	250
Analogue output		
Rise time	[ms]	3
Output, additional data		
Protection against short circuit	Yes	
Electronics		
Operating voltage range DC	[V]	15 ... 35
Protection against incorrect polarity	For operating voltage	
Electromechanical components		
Electrical connection	To EN 60947-5-2	

Pin allocation to EN 60947-5-2		
Plug, 4-pin, only for sensors without analogue output		
M12x1	Pin	Allocation
	1	Operating voltage U_B
	3	0V
	4	Switching output SP1
	2	Switching output SP2
Plug, 5-pin, only for sensors with analogue output		
M12x1	Pin	Allocation
	1	Operating voltage U_B
	3	0V
	5	Analogue output A_{out}
	4	Switching output SP1
	2	Switching output SP2

Pressure sensors SPAW with display

FESTO

Technical data

Mechanical components	G14F	G12M
Mounting position	Any	
Type of mounting	With internal thread, with accessories	With external thread
Pneumatic connection	Internal thread G1¼ (EN 837)	External thread G1½ (DIN 3852-E)
Product weight [g]	230	
Housing material information	ABS, high-alloy stainless steel	
Materials in contact with the medium ¹⁾	High-alloy stainless steel	
Seals	–	NBR

Display/operation	
Display type	LED display, 4-character alphanumeric
Displayable units	Bar
	Kg/cm ²
	kPa
	MPa
	Psi
Switching status display	Red LED
Setting options	Via display and keys
Protection against tampering	PIN code
Threshold value setting range	[%] 0.5 ... 100
Hysteresis setting range	[%] 0.5 ... 99.5

Immissions/emissions	
Protection class	IP65, IP67
Corrosion resistance class CRC ²⁾	4

1) CrNiMo group: 316L, from a measuring range of 10 bar the membrane consists of 13-8-PH

2) Corrosion resistance class 4 to Festo standard 940 070

Components subject to particularly high corrosion stress. Parts used with aggressive media, e.g. in the food or chemical industry. These applications should be supported with special tests with the media if required.

Pressure sensors SPAW with display


Technical data

FESTO


Dimensions

Download CAD Data → www.festo.com/us/cad

SPAW- ... -G12M- ...

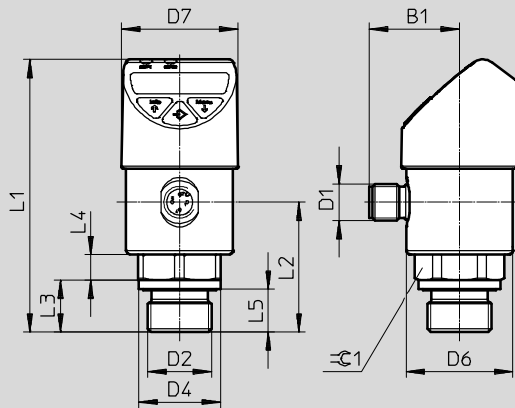

SPAW- ... -G14F- ...

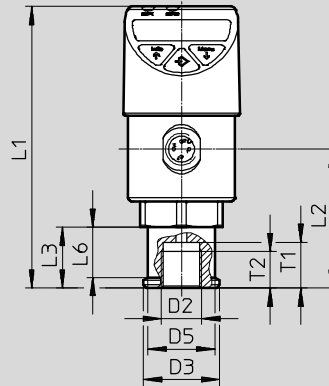

Type	B1	D1	D2	D3 Ø	D4 Ø	D5 Ø	D6 Ø	D7 Ø	L1	L2	L3	L4	L5	L6	T1	T2	⌀
SPAW- ... -G12M- ...	29.5	M12x1	G½	-	26.9	-	35	38	89.4	42.5	17	8.3	14	-	-	-	27
SPAW- ... -G14F- ...	29.5	M12x1	G¼	25	-	22	35	38	92.4	45.5	20	8.3	-	16.5	15	12	27

Pressure sensors SPAW with display

Technical data


FESTO

Ordering data, G $\frac{1}{4}$ internal thread						
Pneumatic connection	Pressure measuring range [bar]	Switching output	Analogue output		Part no.	Type
			[mA]	[V]		
	-1 ... +1	2x PNP	-	-	8022740	SPAW-B2R-G14F-2P-M12
	-1 ... +10				8022741	SPAW-B11R-G14F-2P-M12
	0 ... +2				8022742	SPAW-P2R-G14F-2P-M12
	0 ... +6				8022743	SPAW-P6R-G14F-2P-M12
	0 ... +10				8022744	SPAW-P10R-G14F-2P-M12
	0 ... +16				8022745	SPAW-P16R-G14F-2P-M12
	0 ... +25				8022746	SPAW-P25R-G14F-2P-M12
	0 ... +50				8022747	SPAW-P50R-G14F-2P-M12
	0 ... +100				8022748	SPAW-P100R-G14F-2P-M12
	-1 ... +1	2x NPN	-	-	8022758	SPAW-B2R-G14F-2N-M12
	-1 ... +10				8022759	SPAW-B11R-G14F-2N-M12
	0 ... +2				8022760	SPAW-P2R-G14F-2N-M12
	0 ... +6				8022761	SPAW-P6R-G14F-2N-M12
	0 ... +10				8022762	SPAW-P10R-G14F-2N-M12
	0 ... +16				8022763	SPAW-P16R-G14F-2N-M12
	0 ... +25				8022764	SPAW-P25R-G14F-2N-M12
	0 ... +50				8022765	SPAW-P50R-G14F-2N-M12
	0 ... +100				8022766	SPAW-P100R-G14F-2N-M12
	-1 ... +1	2xPNP	4 ... 20	-	8022776	SPAW-B2R-G14F-2PA-M12
	-1 ... +10				8022777	SPAW-B11R-G14F-2PA-M12
	0 ... +2				8022778	SPAW-P2R-G14F-2PA-M12
	0 ... +6				8022779	SPAW-P6R-G14F-2PA-M12
	0 ... +10				8022780	SPAW-P10R-G14F-2PA-M12
	0 ... +16				8022781	SPAW-P16R-G14F-2PA-M12
	0 ... +25				8022782	SPAW-P25R-G14F-2PA-M12
	0 ... +50				8022783	SPAW-P50R-G14F-2PA-M12
	0 ... +100				8022784	SPAW-P100R-G14F-2PA-M12
	-1 ... +1	2xPNP	-	0 ... 10	8022794	SPAW-B2R-G14F-2PV-M12
	-1 ... +10				8022795	SPAW-B11R-G14F-2PV-M12
	0 ... +2				8022796	SPAW-P2R-G14F-2PV-M12
	0 ... +6				8022797	SPAW-P6R-G14F-2PV-M12
	0 ... +10				8022798	SPAW-P10R-G14F-2PV-M12
	0 ... +16				8022799	SPAW-P16R-G14F-2PV-M12
	0 ... +25				8022800	SPAW-P25R-G14F-2PV-M12
	0 ... +50				8022801	SPAW-P50R-G14F-2PV-M12
	0 ... +100				8022802	SPAW-P100R-G14F-2PV-M12
	-1 ... +1	2x NPN	4 ... 20	-	8022812	SPAW-B2R-G14F-2NA-M12
	-1 ... +10				8022813	SPAW-B11R-G14F-2NA-M12
	0 ... +2				8022814	SPAW-P2R-G14F-2NA-M12
	0 ... +6				8022815	SPAW-P6R-G14F-2NA-M12
	0 ... +10				8022816	SPAW-P10R-G14F-2NA-M12
	0 ... +16				8022817	SPAW-P16R-G14F-2NA-M12
	0 ... +25				8022818	SPAW-P25R-G14F-2NA-M12
	0 ... +50				8022819	SPAW-P50R-G14F-2NA-M12
	0 ... +100				8022820	SPAW-P100R-G14F-2NA-M12
	-1 ... +1	2x NPN	-	0 ... 10	8022830	SPAW-B2R-G14F-2NV-M12
	-1 ... +10				8022831	SPAW-B11R-G14F-2NV-M12
	0 ... +2				8022832	SPAW-P2R-G14F-2NV-M12
	0 ... +6				8022833	SPAW-P6R-G14F-2NV-M12
	0 ... +10				8022834	SPAW-P10R-G14F-2NV-M12
	0 ... +16				8022835	SPAW-P16R-G14F-2NV-M12
	0 ... +25				8022836	SPAW-P25R-G14F-2NV-M12
	0 ... +50				8022837	SPAW-P50R-G14F-2NV-M12
	0 ... +100				8022838	SPAW-P100R-G14F-2NV-M12

Pressure sensors SPAW with display

Technical data

FESTO

Ordering data, G $\frac{1}{2}$ with external thread					
Pneumatic connection	Pressure measuring range [bar]	Switching output	Analogue output		Part no. Type
			[mA]	[V]	
	-1 ... +1	2x PNP	-	-	8022749 SPAW-B2R-G12M-2P-M12
	-1 ... +10				8022750 SPAW-B11R-G12M-2P-M12
	0 ... +2				8022751 SPAW-P2R-G12M-2P-M12
	0 ... +6				8022752 SPAW-P6R-G12M-2P-M12
	0 ... +10				8022753 SPAW-P10R-G12M-2P-M12
	0 ... +16				8022754 SPAW-P16R-G12M-2P-M12
	0 ... +25				8022755 SPAW-P25R-G12M-2P-M12
	0 ... +50				8022756 SPAW-P50R-G12M-2P-M12
	0 ... +100				8022757 SPAW-P100R-G12M-2P-M12
	-1 ... +1	2x NPN	-	-	8022767 SPAW-B2R-G12M-2N-M12
	-1 ... +10				8022768 SPAW-B11R-G12M-2N-M12
	0 ... +2				8022769 SPAW-P2R-G12M-2N-M12
	0 ... +6				8022770 SPAW-P6R-G12M-2N-M12
	0 ... +10				8022771 SPAW-P10R-G12M-2N-M12
	0 ... +16				8022772 SPAW-P16R-G12M-2N-M12
	0 ... +25				8022773 SPAW-P25R-G12M-2N-M12
	0 ... +50				8022774 SPAW-P50R-G12M-2N-M12
	0 ... +100				8022775 SPAW-P100R-G12M-2N-M12
	-1 ... +1	2xPNP	4 ... 20	-	8022785 SPAW-B2R-G12M-2PA-M12
	-1 ... +10				8022786 SPAW-B11R-G12M-2PA-M12
	0 ... +2				8022787 SPAW-P2R-G12M-2PA-M12
	0 ... +6				8022788 SPAW-P6R-G12M-2PA-M12
	0 ... +10				8022789 SPAW-P10R-G12M-2PA-M12
	0 ... +16				8022790 SPAW-P16R-G12M-2PA-M12
	0 ... +25				8022791 SPAW-P25R-G12M-2PA-M12
	0 ... +50				8022792 SPAW-P50R-G12M-2PA-M12
	0 ... +100				8022793 SPAW-P100R-G12M-2PA-M12
	-1 ... +1	2xPNP	-	0 ... 10	8022803 SPAW-B2R-G12M-2PV-M12
	-1 ... +10				8022804 SPAW-B11R-G12M-2PV-M12
	0 ... +2				8022805 SPAW-P2R-G12M-2PV-M12
	0 ... +6				8022806 SPAW-P6R-G12M-2PV-M12
	0 ... +10				8022807 SPAW-P10R-G12M-2PV-M12
	0 ... +16				8022808 SPAW-P16R-G12M-2PV-M12
	0 ... +25				8022809 SPAW-P25R-G12M-2PV-M12
	0 ... +50				8022810 SPAW-P50R-G12M-2PV-M12
	0 ... +100				8022811 SPAW-P100R-G12M-2PV-M12
	-1 ... +1	2xNPN	4 ... 20	-	8022821 SPAW-B2R-G12M-2NA-M12
	-1 ... +10				8022822 SPAW-B11R-G12M-2NA-M12
	0 ... +2				8022823 SPAW-P2R-G12M-2NA-M12
	0 ... +6				8022824 SPAW-P6R-G12M-2NA-M12
	0 ... +10				8022825 SPAW-P10R-G12M-2NA-M12
	0 ... +16				8022826 SPAW-P16R-G12M-2NA-M12
	0 ... +25				8022827 SPAW-P25R-G12M-2NA-M12
	0 ... +50				8022828 SPAW-P50R-G12M-2NA-M12
	0 ... +100				8022829 SPAW-P100R-G12M-2NA-M12
	-1 ... +1	2xNPN	-	0 ... 10	8022839 SPAW-B2R-G12M-2NV-M12
	-1 ... +10				8022840 SPAW-B11R-G12M-2NV-M12
	0 ... +2				8022841 SPAW-P2R-G12M-2NV-M12
	0 ... +6				8022842 SPAW-P6R-G12M-2NV-M12
	0 ... +10				8022843 SPAW-P10R-G12M-2NV-M12
	0 ... +16				8022844 SPAW-P16R-G12M-2NV-M12
	0 ... +25				8022845 SPAW-P25R-G12M-2NV-M12
	0 ... +50				8022846 SPAW-P50R-G12M-2NV-M12
	0 ... +100				8022847 SPAW-P100R-G12M-2NV-M12

Pressure sensors SPAW with display

Accessories

FESTO

Ordering data – Connecting cables				Technical data → Internet: nebu	
	Number of wires/ pins	Cable length [m]	Part no.	Type	
M12x1, straight socket, open end					
	4	2.5	550326	NEBU-M12G5-K-2.5-LE4	
		5	541328	NEBU-M12G5-K-5-LE4	
	5	2.5	541330	NEBU-M12G5-K-2.5-LE5	
		5	541331	NEBU-M12G5-K-5-LE5	
M12x1, angled socket, open end					
	4	2.5	550325	NEBU-M12W5-K-2.5-LE4	
		5	541329	NEBU-M12W5-K-5-LE4	

Ordering data – Push-in fittings ¹⁾				Technical data → Internet: quick star
	For tubing O.D. Ø	Part no.	Type	
	4 mm	190644	QS-1/4-4 ¹⁾	
	6 mm	153003	QS-1/4-6 ¹⁾	
	8 mm	153005	QS-1/4-8 ¹⁾	

1) Temperature-dependent operating pressure –0.95 ... 14 bar

Ordering data – Pipe clamp			
		Part no.	Type
		550598	PQ-RK-22-B

Product Range and Company Overview

A Complete Suite and Company Overview

Our experienced engineers provide complete support at every stage of your development process, including: conceptualization, analysis, engineering, design, assembly, documentation, validation, and production.



Custom Automation Components
Complete custom engineered solutions



Custom Control Cabinets
Comprehensive engineering support
and on-site services



Complete Systems
Shipment, stocking and storage services

The Broadest Range of Automation Components

With a comprehensive line of more than 30,000 automation components, Festo is capable of solving the most complex automation requirements.



Electromechanical
Electromechanical actuators, motors,
controllers & drivers



Pneumatics
Pneumatic linear and rotary actuators,
valves, and air supply



PLCs and I/O Devices
PLC's, operator interfaces, sensors
and I/O devices

Supporting Advanced Automation... As No One Else Can!

Festo is a leading global manufacturer of pneumatic and electromechanical systems, components and controls for industrial automation, with more than 16,000 employees in 60 national headquarters serving more than 180 countries. For more than 80 years, Festo has continuously elevated the state of manufacturing with innovations and optimized motion control solutions that deliver higher performing, more profitable automated manufacturing and processing equipment. Our dedication to the advancement of automation extends beyond technology to the education and development of current and future automation and robotics designers with simulation tools, teaching programs, and on-site services.

Quality Assurance, ISO 9001 and ISO 14001 Certifications

Festo Corporation is committed to supply all Festo products and services that will meet or exceed our customers' requirements in product quality, delivery, customer service and satisfaction.

To meet this commitment, we strive to ensure a consistent, integrated, and systematic approach to management that will meet or exceed the requirements of the ISO 9001 standard for Quality Management and the ISO 14001 standard for Environmental Management.




© Copyright 2013, Festo Corporation. While every effort is made to ensure that all dimensions and specifications are correct, Festo cannot guarantee that publications are completely free of any error, in particular typing or printing errors. Accordingly, Festo cannot be held responsible for the same. For Liability and Warranty conditions, refer to our "Terms and Conditions of Sale", available from your local Festo office. All rights reserved. No part of this publication may be reproduced, distributed, or transmitted in any form or by any means, electronic, mechanical, photocopying or otherwise, without the prior written permission of Festo. All technical data subject to change according to technical update.



Printed on recycled paper at New Horizon Graphic, Inc., FSC certified as an environmental friendly printing plant.

Festo North America

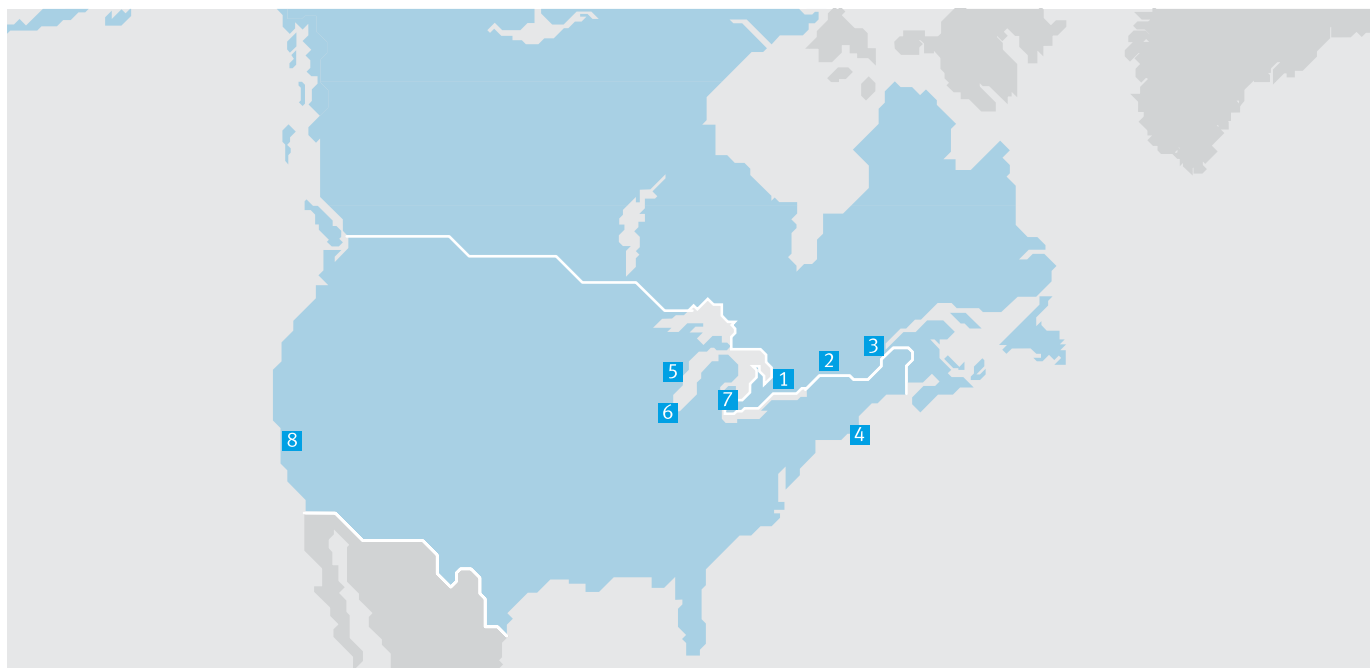

**1 Festo Canada
Headquarters**
Festo Inc.
5300 Explorer Drive
Mississauga, ON
L4W 5G4

2 Montréal
5600, Trans-Canada
Pointe-Claire, QC
H9R 1B6

3 Québec City
2930, rue Watt#117
Québec, QC
G1X 4G3



**4 Festo United States
Headquarters**
Festo Corporation
395 Moreland Road
Hauppauge, NY
11788

5 Appleton
North 922 Tower View Drive, Suite N
Greenville, WI
54942

7 Detroit
1441 West Long Lake Road
Troy, MI
48098

6 Chicago
85 W Algonquin - Suite 340
Arlington Heights, IL
60005

8 Silicon Valley
4935 Southfront Road, Suite F
Livermore, CA
94550

Festo Regional Contact Center

Canadian Customers

Commercial Support:
Tel: 1 877 GO FESTO (1 877 463 3786)
Fax: 1 877 FX FESTO (1 877 393 3786)
Email: festo.canada@ca.festo.com

Technical Support:
Tel: 1 866 GO FESTO (1 866 463 3786)
Fax: 1 877 FX FESTO (1 877 393 3786)
Email: technical.support@ca.festo.com

USA Customers

Commercial Support:
Tel: 1 800 99 FESTO (1 800 993 3786)
Fax: 1 800 96 FESTO (1 800 963 3786)
Email: customer.service@us.festo.com

Technical Support:
Tel: 1 866 GO FESTO (1 866 463 3786)
Fax: 1 800 96 FESTO (1 800 963 3786)
Email: product.support@us.festo.com

Subject to change

Internet: www.festo.com/us